

Work Order ID 141667***141667***

Page 1

Item ID: D209-669-043

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 2/8/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/11/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: SM 20160209 Date: _____ Tooling: _____ Date: _____Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D2906	Rev B (DEO)
-------	-------------

100	Document Control	0.00							
100	DOCUMENT CONTROL								

**945
27
0-00****MAR 31 2016**

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy D209-669 bluefile & type labels per PPP D205-669-043 Chg 003

110		0.00							
-----	--	------	--	--	--	--	--	--	--

110

Skidtubes

Skidtubes

Memo

0.00

Skidtubes

- Inspect mat'l D2500-1-190 for damage

-Drill pilot holes using drill jig DT8149, DT8711-2 & DT8711-3 (Do not use cutting fluid)

-Open holes to 0.500" as per Dwg D2906

-Deburr and blow out all chips from inside of tube. Test fit DT9916 on fwd and aft saddles.

-Acid etch and Alodine tube per QSI 005 4.1

16-2-18**16-2-11****16-2-17**

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐			

Work Order ID 141667

141667

Page 2

Item ID: D209-669-043

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Stop ***NS2***

Start Date: 2/8/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 3/11/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp	DAS 18 9-89
120	QC5- Inspect part completeness to step on W/O	0.00								
120										
QC	Memo	0.00								
Quality Control										

130		0.00								
130										
Skidtubes	Skidtubes	0.00								
Skidtubes	Memo									

-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting
Pick:

Qty Part Number Description Batch
A/R Sikaflex-291 13362
Sikaflex expire date: 16-12-10
Start Time: _____ Date: _____
Fin Time: 4:10 Date: 16-2-22

DP 16-2-22

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid,tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		☐ OTHER : _____					

Work Order ID 141667***141667***

Page 3

Item ID: D209-669-043

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Stop ***NS2***

Start Date: 2/8/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/11/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

0.00

140

BENDING MACHINE - CROSSTUBES

CNC Bend 1

Memo

0.00

CNC Delta 100 Bender

1-Bend as per program COB43FWD & COBRAFT on CNC Bender and Folio FT7&8

2-Cut tubes as per Dwg. D2906



150

0.00

150

Skidtubes

Skidtubes


Memo

0.00

Skidtubes

-Deburr ends and remove marks from bending

- Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002 and dwg. Hold x-bolt with DT9701 Use tube expander 1/2 x17G to start expansion and finish with 1/2 x 18G to achieve dwg dimension.

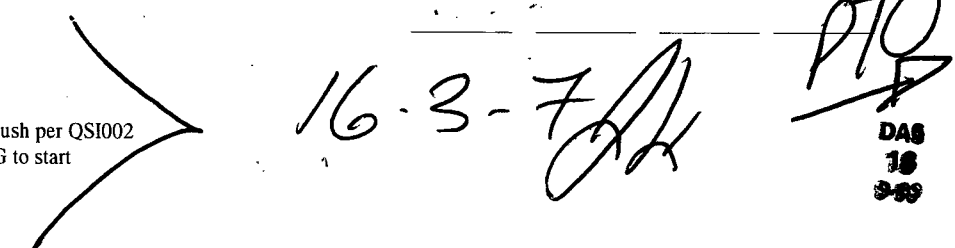

160

0.00

160


QC5- Inspect part completeness to step on W/O

QC

Memo

0.00

Quality Control

DAS
18
9-09

DQA:

Date: 16.04.13



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date: 16/04/13

Work Order update only ☐

Work Order: <u>141667</u> Part No. <u>D209-669-043</u> NCR No. <u>16-5698</u>	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☒ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☒</td> <td>Cross tube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☒	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																	
Skid-tube ☒	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																		
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																		
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																		
Large Fab ☐	Composite ☐	Supplier ☐																																																																			
Date: <u>16/3/13</u>	Step #: <u>140</u>	QTY Effective: <u>1</u>		MRB (QSI042) Approval																																																																	
Description Work Order Deviation		Disposition		DAS 12 8-89 <u>16/3/13</u> Completed By DAS 12 8-89 <u>16/3/13</u> Lead hand / Supervisor Approval Verification <u>16-3-3</u>																																																																	
Fwd bend = 2.2 Aft bend = 1.7 after cutting fwd/aft length 0.1' short.		Acceptable.		QC / QA Coordinator DAS Approval 38 MAR 03 2016																																																																	
Root Cause <table style="width:100%;"> <tr><td>Environment ☐</td><td>No Re-verification ☐</td></tr> <tr><td>Design ☐</td><td>Operator ☐</td></tr> <tr><td>Doc/Data ☐</td><td>Offset/Setup ☐</td></tr> <tr><td>Equip/Tooling ☐</td><td>Supplier ☐</td></tr> <tr><td>Handling/Pre ☐</td><td>Training ☐</td></tr> <tr><td>Material ☐</td><td>Use for Testing ☐</td></tr> <tr><td>Internal Transport ☐</td><td>Poor Information ☐</td></tr> <tr><td>Tribal Knowledge ☐</td><td>Rushing ☐</td></tr> <tr><td>LOA ☐</td><td>Product Improvement ☐</td></tr> <tr><td>Substation ☐</td><td>Process Improvement ☒</td></tr> <tr><td>Past Expiry Date ☐</td><td>Manufacturing Process ☒</td></tr> <tr><td>Misidentified ☐</td><td>Past Due ☐</td></tr> </table>		Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☒	Past Expiry Date ☐	Manufacturing Process ☒	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%;"> <tr> <td>Pressure/Forced ☐</td> <td>Temperature/Cure ☐</td> <td>Power Loss/Surge ☐</td> <td>Positioned Wrong ☐</td> </tr> <tr> <td>Bending ☒</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>				Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☒	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																				
Design ☐	Operator ☐																																																																				
Doc/Data ☐	Offset/Setup ☐																																																																				
Equip/Tooling ☐	Supplier ☐																																																																				
Handling/Pre ☐	Training ☐																																																																				
Material ☐	Use for Testing ☐																																																																				
Internal Transport ☐	Poor Information ☐																																																																				
Tribal Knowledge ☐	Rushing ☐																																																																				
LOA ☐	Product Improvement ☐																																																																				
Substation ☐	Process Improvement ☒																																																																				
Past Expiry Date ☐	Manufacturing Process ☒																																																																				
Misidentified ☐	Past Due ☐																																																																				
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																		
Bending ☒	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																		
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																		
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																		
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																		
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																		
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																		
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																		
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																		
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																		
OTHER: ☐																																																																					

Work Order ID 141667

February 08, 2016 3:52:56 PM

141667

Page 4

Item ID: D209-669-043

Accept

N900040100Setup Start ***NS1***

Révision ID:

Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Stop ***NS2***

Start Date: 2/8/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/11/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

170

0.00

170

Large Fab

Skidtubes

Memo

0.00

Skidtubes

-Drill holes for wearplates using DT8217 Open holes to 19/64", adjust stopper
not to hit web. Debur

-Drill pilot holes for aft & fwd cap using DT8215 open holes to #6" Debur

-Drill pilot holes for Tow ring using DT9555 , open to .640" and Debur

190

QC5- Inspect part completeness to step on W/O

0.00

190

QC

Memo

0.00

Quality Control

② 16-03-09

DAS

9

9-89

DQA:

Date: 16.04.13



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date: 16/04/07

Work Order update only ☐

Work Order: 141667		DISPOSITION		AGAINST DEPARTMENT/PROCESS							
Part No. D209-669-083		Rework ☒		Skid-tube ☒		Cross tube ☐		Water Jet ☐		Engineering ☐	
NCR No. 16-5697		Scrap ☐		Machining ☐		Small Fab ☐		Prod. Eng. Coord. ☐		Quality ☐	
		Use-as-is ☐		Thermoforming ☐		Finishing ☐		Rec/Store/Packaging ☐		Other ☐	
		Suspected Unapproved ☐		Large Fab ☐		Composite ☐		Supplier ☐			
Date: 15-3-7		Step #: 150		QTY Effective: 19				MRB (QSI042) Approval			
Description Work Order Deviation				Disposition				DAS 9 9-89 160307 Completed By 16-3-7 Lead hand / Supervisor Approval Verification 16-3-7 QC / QA Coordinator Approval DAS 9 9-89 160307			
While Swaging, Tool went out of Adjusted Employee Did NOT Notice. Swage depth 1 1/2" deep should be 1"				Remove cross bolts + Re-Swage QTY. 19 D4202-1 B140857							
Root Cause Environment ☐ No Re-verification ☐ Design ☐ Operator ☒ Doc/Data ☐ Offset/Setup ☐ Equip/Tooling ☒ Supplier ☐ Handling/Pre ☐ Training ☐ Material ☐ Use for Testing ☐ Internal Transport ☐ Poor Information ☐ Tribal Knowledge ☐ Rushing ☐ LOA ☐ Product Improvement ☐ Substation ☐ Process Improvement ☐ Past Expiry Date ☐ Manufacturing Process ☐ Misidentified ☐ Past Due ☐				FAULT CATEGORY Pressure/Forced ☐ Temperature/Cure ☐ Power Loss/Surge ☐ Positioned Wrong ☐ Bending ☐ Set-up ☐ Folio/Program ☐ Outside Dimensions ☐ Centre Not Concentric ☐ BOM/Route ☐ Grain ☐ Over/Under tolerance ☒ Cracks ☐ Broken/Damage/Defect ☐ Weld ☐ Part Incorrect ☐ Crimp/Kink/Ripple/Wave ☐ Inspection Incomplete/Unqualified ☐ Wrong Stock Pulled ☐ Part Lost/Missing ☐ Cuffs ☐ Contamination ☐ Out of Sequence ☐ Part Moved ☐ Crushing ☐ Countersink ☐ Off-set ☐ Drawing ☐ Heat Treat ☐ Cut Too Short ☐ Mislabeled ☐ Finish ☐ Wave/Twist in Tube ☐ Instructions Incomplete/Unclear ☐ Fit/Function ☐ Misread ☐ Marks/Chatter ☐ Drill Holes ☐ Misaligned/off center ☐ Turning Sequence ☐ OTHER: ☐							

Work Order ID 141667

February 08, 2016 3:52:56 PM

141667

Page 5

Item ID: D209-669-043

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates; Fits LH or RH

Stop ***NS2***

Start Date: 2/8/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/11/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200	Pressure Wash per QSI005 4.3	0.00							
200 HandFinish Hand Finishing	Memo	0.00							1 of 16-03-9. 03 34 9-89
210	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
210 Powdercoat Powder Coating	Memo START TIME: 1:35 OVEN TEMPERATURE: 320° FINISH TIME: 2:05	0.00							1 of 16-03-9. 03 34 9-89
220	QC3- Inspect Part Finish	0.00							
220 QC Quality Control	Memo	0.00							1 of 16-03-09 15 15 9-89 DAS

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
☐ OTHER : _____					

Work Order ID 141667

141667

Page 6

February 08, 2016 3:52:56 PM

Item ID: D209-669-043

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 2/8/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/11/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230		0.00							
230	HandFinishing					1x	✓	11116103110	
HandFinish	Memo	0.00							
Hand Finishing	1-Install inserts & wearplates as per Dwg. D2906. Use a drop of Sikaflex on insert holes before installing wearplates A/R Sikaflex-291 11133863 Sikaflex expire date: 16112								
	2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2906 RTU 598 M142260 16102								
	3-Inspect for foreign object per QSI 024								
	4-Install D2855 Fwd & Aft Cap as per Dwg D2906 and seal Fwd & Aft Cap with Sikaflex. Clean excess adhesive A/R Sikaflex-291 11133862 Sikaflex expire date: 16112								
	5-Wing Walk as per Dwg D2906 and QSI 005 4.4 Batch: 11174134								

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 141667***141667***

Page 7

Item ID: D209-669-043

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 2/8/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/11/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240	QC5- Inspect part completeness to step on W/O	0.00							
240									DAS
QC	Memo	0.00							38
Quality Control	Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024								8-89 MAR 14 2016
250	Packaging	0.00							
250									DAS DAS
Packaging	Memo	0.00							28 27
Packaging	Identify and pack for shipping as per PPP 209-669-043								8-89 8-89 MAR 31 2016
	Location: _____								
	PPP Rev: _____								
260	QC21- Final Inspection - Work Order Release	0.00							
260									
QC	Memo	0.00							
Quality Control									MCS APR 01 2016

MCS APR 01 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

February 08, 2016 3:53:00 PM

141667

D209-669-043

Required Date: 3/11/2016

Required Qty: 1.00

Comments: new IPP 08.02.13 LL, verified by: DD
IPP Rev:B remove DT # in seq140 DD 10.03.10 Verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D4202-1 *D4202-1* Spacer		Manufactured	No				Each	51.0000		19			
				<u>Location</u>			<u>Loc Qty</u>			<u>Loc Code</u>			
				LG001	140857		51						
					134465		1						
					135848		1						
					136610		49						
D2500-1-190 *D2500-1-190* Ext'n -1" Beam Tube 4"		Manufactured	No			110	Each	22.0000	1	1			
				<u>Location</u>			<u>Loc Qty</u>			<u>Loc Code</u>			
				HALL			22						
					134259		22						
D2500-1-190RevU/R *D2500-1-190RevU/R* Ext'n -1" Beam Tube 4"		Manufactured	No			110	Each	0.0000	1	1			
D2926-3 *D2926-3* Web		Manufactured	No			110	Each	0.0000	1	1			
D2926-3RevA *D2926-3RevA* Web		Manufactured	No			110	Each	0.0000	1	1			
D2579RevE *D2579RevE* Crossbolt Spacer		Manufactured	No			170	Each	0.0000	19	19			

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

February 08, 2016 3:53:00 PM

Page 2

Work Order ID: 141667

141667

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 2/8/2016

Required Date: 3/11/2016

Start Qty: 1.00

Required Qty: 1.00

D2855 Manufactured No

230 Each

84.0000

2

2

D2855

Cap

HL 16/03/16

Location

Loc Qty

Loc Code

FP001

84

134027

34

137568

50

XZ

D2855RevA

Manufactured No

230 Each

0.0000

2

2

D2855RevA

Cap

AN3-5A

Purchased No

230 Each

212.0000

4

4

AN3-5A

Bolt

HL 16/03/16

Location

Loc Qty

Loc Code

FP001

22

m133686

22

ST350

190

m133686

70

m134055

120

XZ

AN960JD10L

NAS1149D0332J

Purchased No

230 Each

39.0000

4

4

AN960JD10L

Washer

Location

Loc Qty

Loc Code

CA

39

M129682

39

February 08, 2016 3:53:00 PM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Picklist Print

February 08, 2016 3:53:00 PM

Page 3

Work Order ID: 141667

141667

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 2/8/2016

Required Date: 3/11/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1149D0332J

Purchased

No

230

Each

1,481.000

4

4

NAS1149D0332.J

Washer

16/03/10

Location

Loc Qty

Loc Code

CA

14

m129682

14

FP001

58

m129682

58

GA

155

m132677

155

ST260a

600

m133988

600

ST264

654

m133498

654

ALS7-1032-130

AELS8-1032-130 Purchased

No

230

Each

2,580.000

44

44

ALS7-1032-130

Rivnut

16/03/10

Location

Loc Qty

Loc Code

FG

100

M128649

100

FP001

1157

M128649

1157

st549

1323

M128649

1323

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Skid-tube ☐</td> <td style="width: 15%;">Cross tube ☐</td> <td style="width: 15%;">Water Jet ☐</td> <td style="width: 15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																															
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																				
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																				
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																																
Description Work Order Deviation				Disposition				Completed By																																																															
								Lead hand / Supervisor Approval Verification																																																															
										QC / QA Coordinator Approval																																																													
Root Cause <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Environment ☐</td> <td style="width: 15%;">No Re-verification ☐</td> </tr> <tr> <td>Design ☐</td> <td>Operator ☐</td> </tr> <tr> <td>Doc/Data ☐</td> <td>Offset/Setup ☐</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> </tr> </table>		Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Pressure/Forced ☐</td> <td style="width: 15%;">Temperature/Cure ☐</td> <td style="width: 15%;">Power Loss/Surge ☐</td> <td style="width: 15%;">Positioned Wrong ☐</td> </tr> <tr> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>						Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																						
Design ☐	Operator ☐																																																																						
Doc/Data ☐	Offset/Setup ☐																																																																						
Equip/Tooling ☐	Supplier ☐																																																																						
Handling/Pre ☐	Training ☐																																																																						
Material ☐	Use for Testing ☐																																																																						
Internal Transport ☐	Poor Information ☐																																																																						
Tribal Knowledge ☐	Rushing ☐																																																																						
LOA ☐	Product Improvement ☐																																																																						
Substation ☐	Process Improvement ☐																																																																						
Past Expiry Date ☐	Manufacturing Process ☐																																																																						
Misidentified ☐	Past Due ☐																																																																						
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																				
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																				
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																				
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																				
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																				
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																				
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																				
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																				
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																				
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																				
		OTHER : ☐																																																																					

Picklist Print

February 08, 2016 3:53:00 PM

Page 4

Work Order ID: 141667

141667

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 2/8/2016

Required Date: 3/11/2016

Start Qty: 1.00

Required Qty: 1.00

AN3C4A

Purchased

No

230

Each

793.0000

44

44

AN3C4A

Bolt

Handwritten: 1260360

Location

Loc Qty

Loc Code

FG

20

122814

20

FP001

409

M133440

7

M134055

402

Handwritten: X44

ST350

364

M134055

164

M134134

200

AN960C10L

NAS1149C0332

Purchased

No

230

Each

0.0000

44

44

AN960C10L

Washer

NAS1149C0332R

Purchased

No

230

Each

5,487.000

44

44

NAS1149C0332R

WASHER

Handwritten: 1260310

Location

Loc Qty

Loc Code

FP001

2668

m132262

4

m132930

1004

m134073

1660

GA

76

m133284

76

ST266

2743

m133284

743

m134063

2000

Handwritten: X44

February 08, 2016 3:53:00 PM

Shop Packet Print

Page 4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
				Completed By					
				Lead hand / Supervisor Approval Verification					
				QC / QA Coordinator Approval					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
OTHER : ☐									

Picklist Print

February 08, 2016 3:53:00 PM

Page 5

Work Order ID: 141667

141667

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 2/8/2016

Required Date: 3/11/2016

Start Qty: 1.00

Required Qty: 1.00

D2594-3 Manufactured No 230 Each 628.0000 14 14

D2594-3

O-Ring

all 16/03/16

Location

Loc Qty

Loc Code

FP001

628

134838

116

135859

24

137829

118

138060

170

140770

200

X 14

D2594-3RevC

DAS

Manufactured No

230 Each

0.0000

14

14

D2594-3RevC

O-Ring, 205 Skidtube

D2594-1

Manufactured No

230 Each

275.0000

14

14

D2594-1

Plug

all 16/03/16

Location

Loc Qty

Loc Code

FP001

275

119830

68

134804

16

135914

21

136657

36

138397

100

42807

27

88922

7

X 14

D2594-1RevC

DAS

Manufactured No

230 Each

0.0000

14

14

D2594-1RevC

Plug, 205 Skidtube

February 08, 2016 3:53:00 PM

Shop Packet Print

Page 5

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Picklist Print

February 08, 2016 3:53:01 PM

Page 6

Work Order ID: 141667

141667

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 2/8/2016

Required Date: 3/11/2016

Start Qty: 1.00

Required Qty: 1.00

D3564-9 Manufactured No 230 Each 20.0000 1 1

D3564-9

Wearplate Fwd

all 12/03/10

Location

Loc Qty

Loc Code

FG

6

76950

4

88407

2

FP002

14

137699

14

D3564-9RevD

DAS

Manufactured No

230 Each

0.0000

1

1

D3564-9 RevD

Wearshoe

D3564-11

Manufactured No

230 Each

6.0000

1

1

D3564-11

Wearplate Aft

all 12/03/10

Location

Loc Qty

Loc Code

FG

6

77056

4

85473

2

B 140820

D3564-11RevD

Manufactured No

230 Each

0.0000

1

1

D3564-11 RevD

Wearshoe

xl

February 08, 2016 3:53:01 PM

Shop Packet Print

Page 6

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

February 08, 2016 3:53:01 PM

Page 7

Work Order ID: 141667

141667

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 2/8/2016

Required Date: 3/11/2016

Start Qty: 1.00

Required Qty: 1.00

D3564-5 Manufactured No

230

Each

25.0000

1

1

D3564-5

Wearplate Center

all 16103/16

Location

Loc Qty

Loc Code

FG

3

34806

1

89048

2

FP002

22

137634

3

140818

19

x1

D3564-5RevD Manufactured No

230

Each

0.0000

1

1

~~***D3564-5RevD***~~

Wearshoe

DAS
9-89

D3566-1 Manufactured No

230

Each

39.0000

2

2

D3566-1

Gasket Aft / Fwd

all 16103/16

Location

Loc Qty

Loc Code

FG

8

117012

4

~~8110818~~

96430

2

98981

2

FP001

31

139221

8

140819

23

x2

D3566-1RevC Manufactured No

230

Each

0.0000

2

2

~~***D3566-1RevC***~~

Gasket

DAS

9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause				FAULT CATEGORY			
Environment ☐	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐
Design ☐	☐	Operator	☐	Bending	☐	Set-up	☐
Doc/Data ☐	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐
Equip/Tooling ☐	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐
Handling/Pre ☐	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐
Material ☐	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐
Internal Transport ☐	☐	Poor Information	☐	Crushing	☐	Countersink	☐
Tribal Knowledge ☐	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐
LOA ☐	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐
Substation ☐	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐
Past Expiry Date ☐	☐	Manufacturing Process	☐				
Misidentified ☐	☐	Past Due	☐				

Picklist Print

February 08, 2016 3:53:01 PM

Page 8

Work Order ID: 141667

141667

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 2/8/2016

Required Date: 3/11/2016

Start Qty: 1.00

Required Qty: 1.00

D3566-5

Manufactured No

230

Each

6.0000

1

1

D3566-5

Gasket Center Aft

Handwritten signature and date 16/63/16

Location

Loc Qty

Loc Code

FG

2

94119

2

B140942

FP001

4

139236

4

D3566-5RevC

Manufactured No

230

Each

0.0000

1

1

~~***D3566-5RevC***~~

Gasket

DAS
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								



QTY -041	QTY -043	Part Number	Description
X		D2906-041	SKIDTUBE ASSEMBLY
	X	D2906-043	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
22	19	D2579	CROSS BOLT SPACER
12	14	D2594-1	PLUG
12	14	D2594-3	O-RING
2	2	D2855	AFT CAP
1		D2926-1	WEB
	1	D2926-3	WEB
1	1	D3564-9	WEARSHOE (REPLACES D2577-1)
1	1	D3564-11	WEARSHOE (REPLACES D2577-3)
1	1	D3564-5	WEARSHOE (REPLACES D2577-5)
1		D3564-15	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1		D3566-15	GASKET
50	44	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or ALS4-1032-130	INSERT
50	44	AN3C4A	BOLT
4	4	AN3-5A	BOLT
50	44	AN960C10L	WASHER
4	4	AN960JD10L	WASHER

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) LENGTH OF D2500-1 EXTRUSION BEFORE BENDING = 190 INCHES.
- 3) INSERT D2926-1/-3 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 6) USE DART DRILL TEMPLATE DT2906-041T1 (D2906-041) OR DT2906-043T1 (D2906-043) TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION C-C AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/291.
- 7) WELDING TO BE DONE PER DART QSI 004.
- 8) FINISH:
ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2926-1/-3 WEB. POWDER COAT ASSEMBLY WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- 9) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (12 PLACES).
- 10) ALL DIMENSIONS ARE IN INCHES.

20160209

SH 141067

RELEASED

07.09.04

B	UPDATE DRAWING FORMAT; RE-ORGANIZE; ADD STAINLESS STEEL WEARPLATES AND GASKETS CHANGE WEARPLATE HARDWARE TO SS; PG 1: ADD NOTE 10; PG 2 C7: REMOVE AFT Ø0.640 HOLE FROM -041; PG 3 C3: CORRECTED -043 CAP P/N; PG 3 D7: 38 PLACES WAS 44 PLACES;	CB	07.08.21
A	NEW ISSUE	CP	04.06.22
REV.	DESCRIPTION	BY	DATE
DESIGN	qp	DART AEROSPACE LTD	
DRAWN	CB	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. B
MFG. APPR.	SH	D2906	SHEET 1 OF 3
APPROVED	SH	TITLE	SCALE
DE APPR.	SH	AH-1 (209) SKIDTUBE ASSEMBLY	NTS
DATE	07.08.21	COPYRIGHT © 2004 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					


8 7 6 5 4 3 2 1

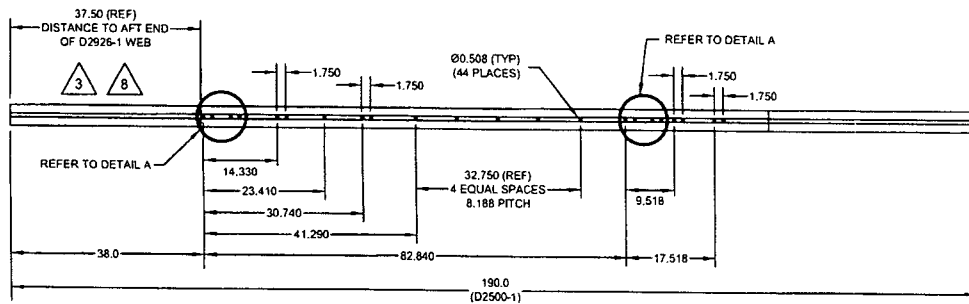


D2906-1 DRILLING DETAIL

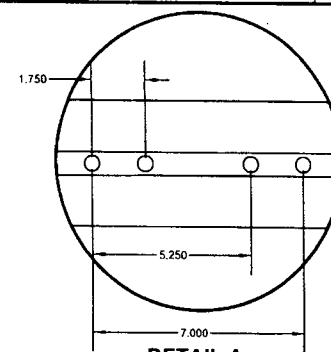

DETAIL A
SCALE 1:4

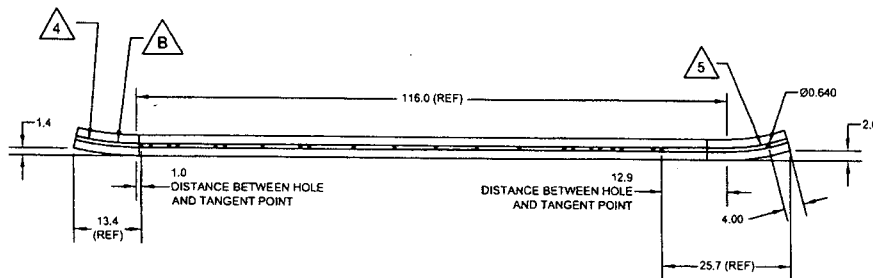


D2906-041 BENDING AND CUTTING DETAIL

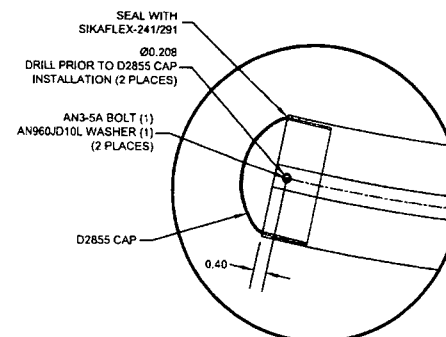


DETAIL B
SCALE 1:4

RELEASED

07.09.04

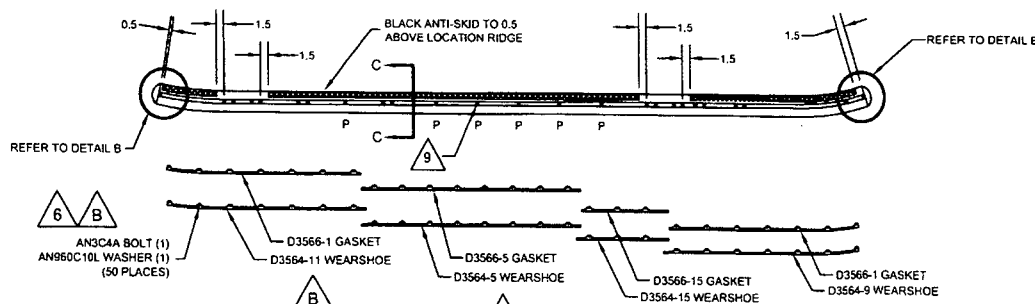


D2906-041 ASSEMBLY DETAIL

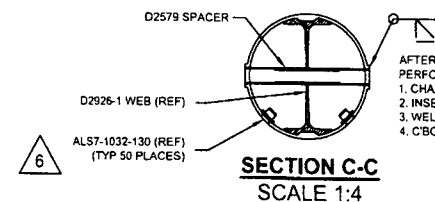


SECTION C-C
SCALE 1:4

DESIGN	9	DART AEROSPACE LTD	
DRAWN	C.B.	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO. D2906	REV. B
MFG. APPR.	PH		SHEET 2 OF 3
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	AH-1 (209) SKIDTUBE ASSEMBLY	1:24
DATE	07.08.21	COPYRIGHT © 2004 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


8 7 6 5 4 3 2 1

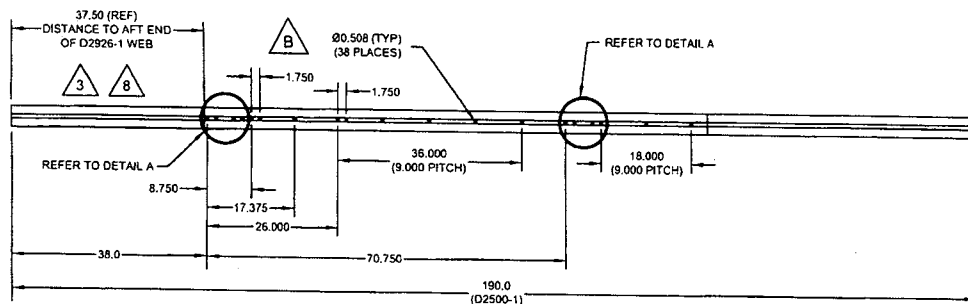


D2906-3 DRILLING DETAIL

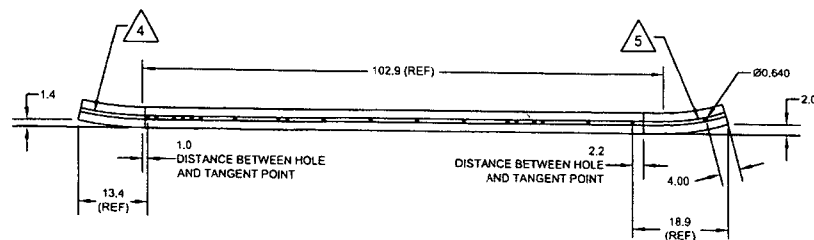


D2906-043 BENDING AND CUTTING DETAIL

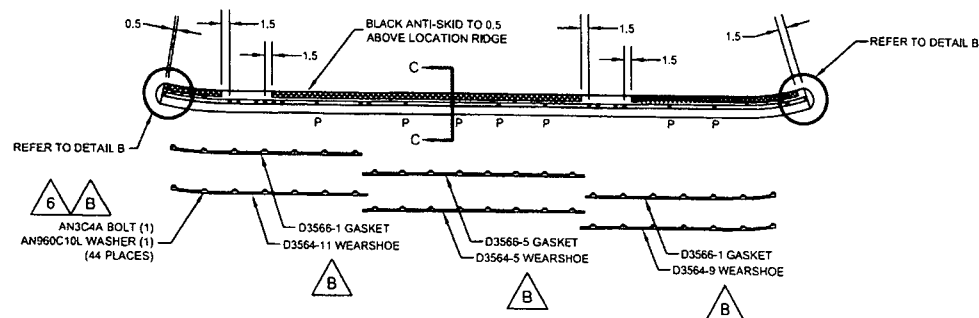

D2906-043 ASSEMBLY DETAIL

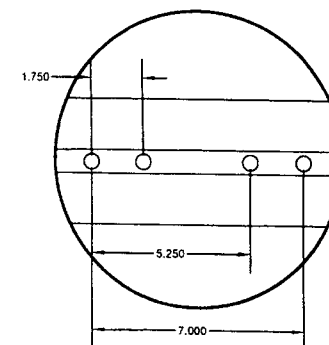


DETAIL A
SCALE 1:4

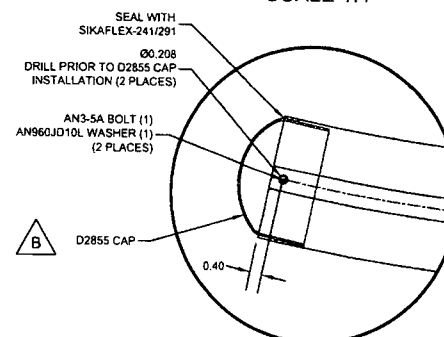

DETAIL B
SCALE 1:4

RELEASED
07.09.04

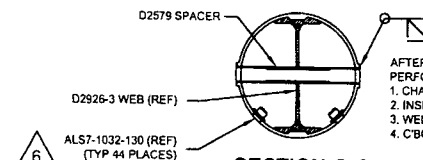

SECTION C-C
SCALE 1:4

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (22 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

DESIGN	4P	DART AEROSPACE LTD	
DRAWN	CB	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. B
MFG. APPR.	21	D2906	SHEET 3 OF 3
APPROVED	4P	TITLE	SCALE
DE APPR.	4P	AH-1 (209) SKIDTUBE ASSEMBLY	1:24
DATE	07.08.21	COPYRIGHT © 2004 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DRAWING NO. D2906	TITLE AH-1 (209) SKIDTUBE ASSEMBLY	REV. B	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D2906-B-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN A.P.	CHECKED <i>[Signature]</i>	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>		DE APPR. <i>[Signature]</i>		
DATE 12.05.28	DATE 12.05.28	DATE 12.05.31	DATE 12.05.31		DATE 12.05.31		

PURPOSE:

CHANGE ALL C'BORED WELDED CROSSBOLT SPACERS TO SWAGED SPACERS

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

WAS


QTY	QTY	PART NUMBERS	DESCRIPTION
-041	-043		
22	19	D2579	CROSS BOLT SPACER

IS

22	19	D4202-1	SPACER
----	----	---------	--------

SECTION C-C ON SHEETS 2 & 3 ARE AMENDED AS FOLLOWS FOR ALL HOLES THAT WERE ORIGINALLY C'BORED:

RELEASED
2012-06-05
[Signature]

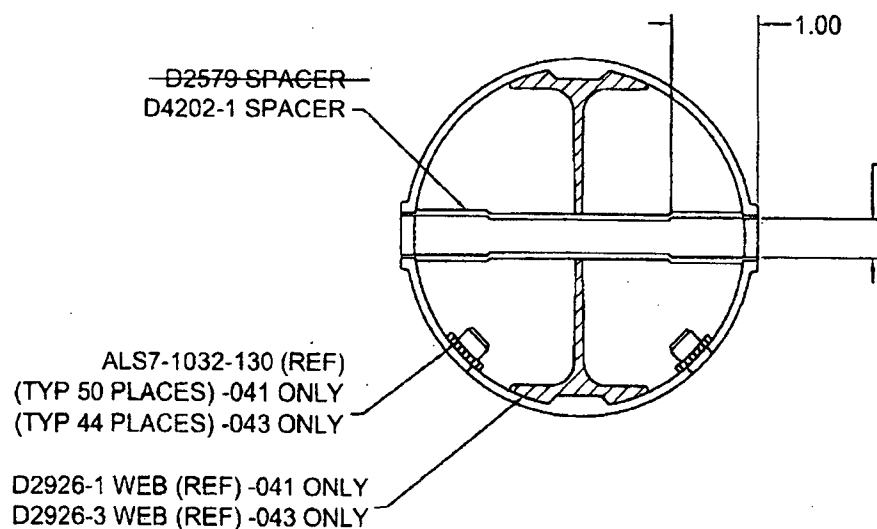

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

1. INSERT D4202-1 SPACER, 22 PL (-041) OR 19 PL (-043)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002

SECTION C-C A2-2
NOT TO SCALE A2-3